


Service Information Number: SI-003

Subject: Gasket 82-50130-B verses 82-50130 Gasket.

Applicability: Where Gasket 82-50130 is required when mounting a dry air pump.


The 82-50130 gasket incorporates 8 small holes for accessories that require engine oil lubrication. The oil passage holes have been eliminated in the 82-50130-B mounting gasket. The LRT diverter is required on the Aero Accesories Dry Air Pumps that have channels milled into their mounting flange faces. Either the 82-50130 or 82-50130-B gaskets can be used with the LRT diverter, however the '-B' gasket is preferred due to its increased sealing capability.

Oil Passage Holes - Not required in Dry Air Pump Installations

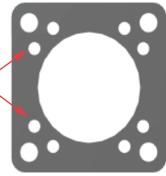

Standard 82-50130 Gasket

LRT Diverter - Used with either Gasket dependent upon pump flange being milled to accept LRT

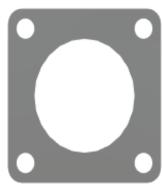

82-50130-B Gasket

Mounting Flange Face Machined, LRT REQUIRED with Gasket 82-50130(-B)



Mounting Flange Face Not Machined, **LRT NOT REQUIRED** with Gasket 82-50130(-B)



ISSUED			REVISED		
МО	DAY	YR	МО	DAY	YR
04	15	08	00	00	00

71
Aero Accessories, Inc.

Aero Accessories, Inc.
1240 Springwood Avenue
Gibsonville, N.C. USA

PAGE No.	REVISION	1
1 of 1	Original	